

## Investigation on the Electrochemical Behavior of Cobalt-Nitroso R Salt and Its Analytical Application

### I . Determination of Trace Amounts of Cobalt By Oscillopolarography

Zou Hong<sup>\*</sup> Wang Yan-jun<sup>2</sup> Zhu Ruo-hua<sup>1</sup> Li Wenjun<sup>1</sup> Gu Xue-xin<sup>1</sup>

(1. Department of Chemistry ,Capital Normal University,Beijing 100037, )

(2. Public security Department of Sichuan Province,Chengdu 610041, )

**Abstract** Cobalt and nitroso R salt in the buffer solution of NaCO<sub>3</sub>-NaHCO<sub>3</sub>(pH9. 70)in the presence of tetradeethyl pyridinium chloride can yield a very sensitive, adsorptive oscillopolarographic current at -0. 74V (vs. SCE). The detection limit was 0. 8ng/L (the secondary derivative). The proposed method has been applied to the determination of trace amounts of cobalt in the water and biological samples and the results were accurate and reliable.

**Key words** Cobalt nitrosos R salt oscillopolarographic determination

## 美国 NOVA4 电解质分析仪液流系统常见故障排除两例

倪世杰 刘永文

(吉林省通化市 206 医院 134001)

美国 NOVA4 电解质分析仪以快速、准确、打印、自动定标、进样、保养及故障自诊等优点深受欢迎，现将几年来仪器的液流通路常见故障的排除经验介绍如下，以供参考。

液流通路发生阻塞部位常有两处：

1. CO<sub>2</sub> 电极膜与 CO<sub>2</sub> 电极套筒的间隙处有污物。仪器显示“03020 NO Sample (无标本)、03031FLow Time Too long”流动时间太长等的字样。因为该间隙处，液流面积大，间隙狭窄，液流速度慢，一些细小的蛋白凝块、尘埃等易积滞于此，积附的有些成分对 CO<sub>2</sub> 电极膜会有不同程度的损害，直接影响到 T<sub>CO<sub>2</sub></sub> 的准确测定；通过程序“FLOWPATH”(流动路径)保养冲洗及定标很难恢复到仪器的正常工作状态。取下电极套，开锁，小心地拧 CO<sub>2</sub> 电极并垂直拔出，用去离子水轻轻冲洗电极膜，注意不要触摸电极膜，然后用充满 NOVA4 专用清洗剂的注射器，反复冲洗

CO<sub>2</sub> 电极磁筒底部的液流孔直至排出污物。再用去离子水冲洗2~3遍，方可安装复位。保养定标后，仪器工作正常。

2. 金属吸样针内部堵塞，屏显“03020 NO Sample”等错误代码，并发出蜂鸣报警。故障原因经常是由于血清离心效果不好，标本吸入后，大量的纤维蛋白凝块迅速堵塞针孔。打开机的前盖，从吸样针上拔下 S 管，拧下吸样针顶端螺母，拔出吸样针，用 20cm 钢针反复通透其内部针孔，然后用注满去离子水的注射器反复冲洗 5 遍，直至堵塞污物全部流出为止。重新安装好吸样针，开机正常。

总之，以上两种故障是液流系统故障的好发部位，为了减少故障发生，严格按着使用操作规程，做好日常保养，尤其应注意 FLOWPATH 保养，以确保电极处于正常工作状态。